


# FXYx 3 axes / ZT

- Arm type
- Cable carrier
- Z-axis: clamped base / moving table type (60W)

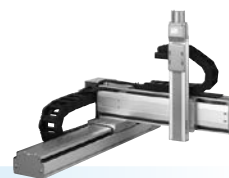

## Ordering method

**FXYx - C** - **ZT6L - 12** - **RCX340-3**

Model	Cable	Combination	X-axis stroke	Y-axis stroke	ZR-axis	Lead	Z-axis stroke	Cable	Controller / Number of controllable axes	Safety standard	Option A (OP.A)	Option B (OP.B)	Option C (OP.C)	Option D (OP.D)	Option E (OP.E)	Absolute battery
		A1	15 to 105cm	15 to 55cm			5 to 30cm	3L: 3.5m 5L: 5m 10L: 10m								

Specify various controller setting items. RCX340 ▶ **P678**

## Specification

	X-axis	Y-axis	Z-axis
Axis construction <sup>Note 1</sup>	-	-	T6L-12-BK
AC servo motor output (W)	100	60	60
Repeatability <sup>Note 2</sup> (mm)	+/-0.01	+/-0.02	+/-0.02
Drive system	Ball screw φ15	Ball screw φ12	Ball screw φ12
Ball screw lead <sup>Note 3</sup> (Deceleration ratio) (mm)	20	12	12
Maximum speed <sup>Note 4</sup> (mm/sec)	1200	800	800
Moving range (mm)	150 to 1050	150 to 550	50 to 300
Robot cable length (m)	Standard: 3.5 Option: 5,10		

Note 1. Use caution that the flame machining (installation holes, tap holes) differs from single-axis robots.  
 Note 2. Positioning repeatability in one direction.  
 Note 3. Leads not listed in the catalog are also available. Contact us for details.  
 Note 4. When the X-axis stroke is longer than 750mm, resonance of the ball screw may occur depending on the operation conditions (critical speed). In this case, reduce the speed setting on the program by referring to the maximum speeds shown in the table below.


## Maximum payload (kg)

Y stroke (mm)	ZT
150 to 550	3

## Controller

Controller	Operation method
RCX340	Programming / I/O point trace / Remote command / Operation using RS-232C communication

## FXYx 3 axes / ZT A1

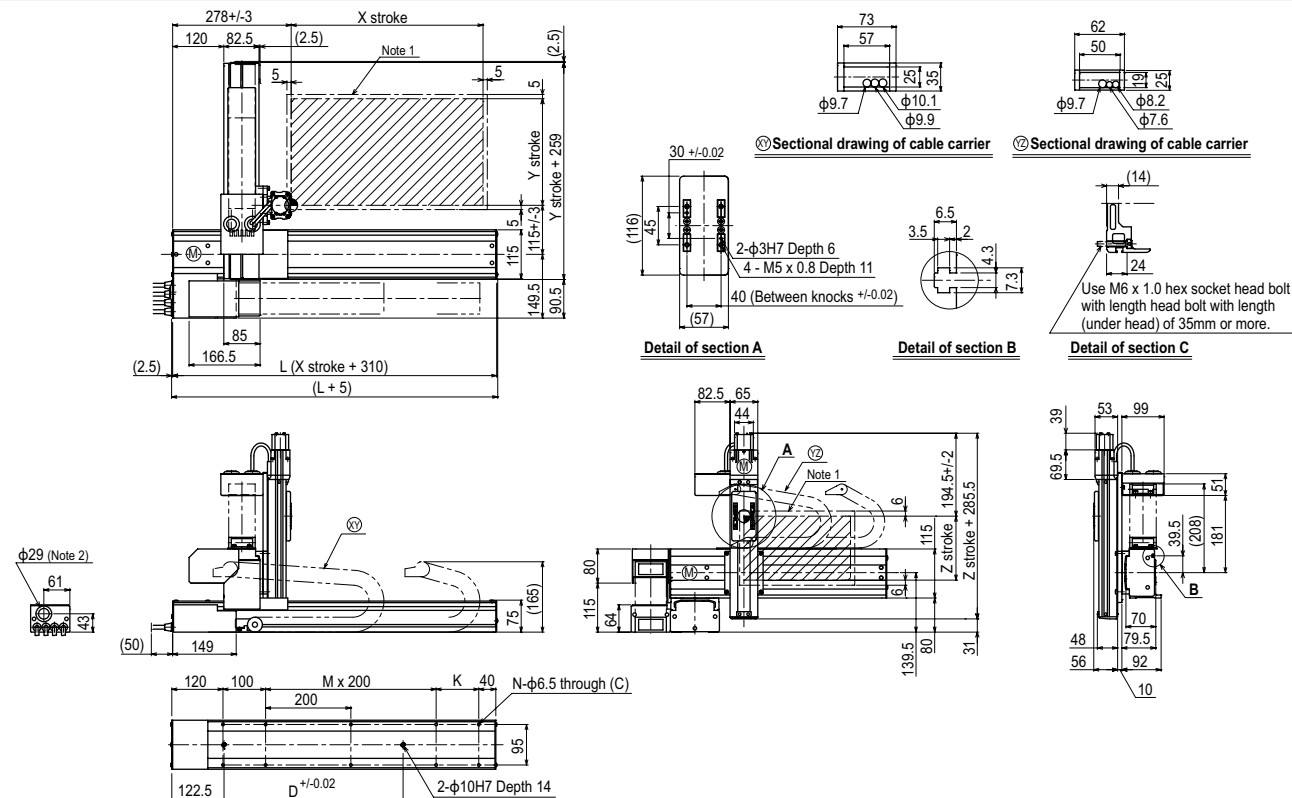

X stroke	150	250	350	450	550	650	750	850	950	1050
L	460	560	660	760	860	960	1060	1160	1260	1360
K	200	100	200	100	200	100	200	100	200	100
D	240	240	420	420	600	600	780	960	960	1140
M	0	1	1	2	2	3	3	4	4	5
N	6	8	8	10	10	12	12	14	14	16
Y stroke	150	250	350	450	550					
Z stroke	50	100	150	200	250	300				
Maximum speed for each stroke (mm/sec) <sup>Note 1</sup>	1200					960	780	600	540	
Speed setting	-					80%	65%	50%	45%	

Note 1. The moving range when returning to origin and the stop position when stopping by the mechanical stopper.  
 Note 2. User cable extraction port.

Note 3. When the X-axis stroke is longer than 750mm, resonance of the ball screw may occur depending on the operation conditions (critical speed). In this case, reduce the speed setting on the program by referring to the maximum speeds shown in the table at the left.